



# Smart temperature transmitter LI-24ALW

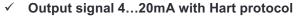

- ✓ Galvanic insulation (In, Out)
- ✓ Programmable sensor type
- √ Programmable measuring range
- ✓ Thermoresistance line compensation
- ✓ Compensation of thermocouple cold junction
- ✓ Autodiagnostic system
- ✓ Intrinsic safety certificate (ATEX, IECEx)
- ✓ Explosion proof certificate (ATEX, IECEx)
- √ Safety version SIL2/SIL3

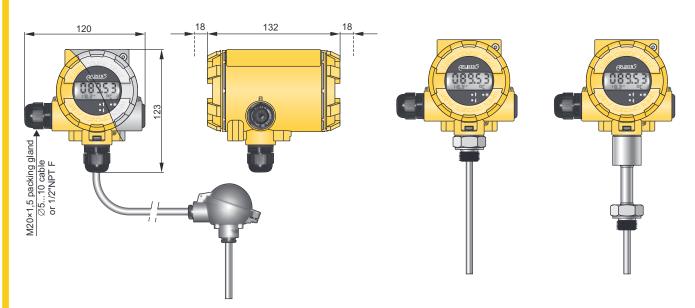

LI-24ALW with remote mounted temperature sensor

LI-24ALW with direct mounted temperature sensor

#### **Application and function**

The temperature transmitter LI-24ALW is applicable to converting resistance of temperature or voltage of thermocouple sensor to standard current signal 4-20mA. The transmitter has two separate channels enabling measurement of temperature difference, averange, averange with redundancy, max. or min. temperature. Transmitter has compensation of ambient temparature influence and compensation of thermocouple cold junction using internal/external (Pt100) sensor or constant temperature. Most of parameters such as: sensor type, measuring range, current alarm signal when electric circuit is broken, output characteristic correction, user characteristic (60 points) are programmed using PC with HART/USB converter and Aplisens RAPORT 2 configuration software. For request Aplisens can set temperature transmitter parameters like measuring range, type of sensor. Their values are printed on label. Transmitter LI-24/ALW is designed for field use. LI-24ALW can be used with temprature sensors mounted directly in transmitter's casing or with external sensors connected with cable.



### **Technical data**

Input signal	Resistance: Pt100,Ni100
Input signal	Voltage: K, J,S,B,N,T, R, E
Limit process	-10mV< E<100mV or -100mV< E<1000mV
Limit process	$0\Omega$ <r<400<math>\Omega or <math>0\Omega</math><r<2000<math>\Omega</r<2000<math></r<400<math>
Min. measuring range	10mV or 10Ω or 10K
Output signal	4 - 20 mA + Hart
	13,5*55 VDC
	Exia: 13,5*30 VDC
Power supply	Exd: 13,5*45 VDC
1 Ower suppry	Safety, Safety Exd: 12,536 VDC
	Safety Exia: 12,530 VDC
	*- with display illumination switched on +3V, display backlight can be switched on only during production
Max. wires resistance	$500\Omega$
Alarm signal	3,75mA / 21,5mA (NORMAL) or 3,6 mA / 21 mA (NAMUR NE89) or setting by user
Sensor current	0,42mA
Sensor current	Safety: 0,25mA
Galvanic insulation	Optoelectrical
Time constant	0,3s
Additional electronic damping	030s
·	-40+80°C
	Exia: -40+80°C
Ambient temperature	Exd: -40+75°C
	Safety: -40+85°C
	Safety Exia, Safety Exd: -40+75°C


LI-24ALW/Safety can be programed only with HART protocol. Local buttons allows only to change display settings.

## Type of input signals and metrological parameters


	RTD sensors		Thermocouples			
			Input impedance	t impedance $>10M\Omega$		
Thermal resistance sensors 2, 3 or 4 wires connection			Maximum wires resistance 500 $\Omega$ (wires + thermocouple		(wires + thermocouple)	
Sensor current	Sensor current ~250 µA			Cold junctions compensation Internal sensor,		
Maximum wires resistance $25 \Omega$					nal sensor Pt100, tant value	
Sensor type	Basic range (FSO)	Min. range span	Sensor type	Basic range (FSO)	Min. range span	
	°C	K		°C	K	
Pt100	-200÷850	10	В	500÷1820	50	
Pt200	-200÷850	10	E	-150÷1000	50	
Pt500	-200÷850	10	J	-210÷1200	50	
Pt1000	-200÷266	10	K	-150÷1372	50	
Ni100	-60÷180	10	N	-150÷1300	50	
Cu100	-50÷180	10	R	50÷1768	50	
			S	50÷1768	50	
			Т	-150÷400	50	
Pasistan	Desistance (maister material material			-25÷75	-	
Resistance (resistor, potentiometer)			Voltage			
	Ω	Ω		mV	mV	
Measuring range No.1	0÷400	10	Measuring range No.1	-10÷100	10	
Measuring range No. 2	0÷2000	10	Measuring range No. 2	-100÷1000	10	



## **Electrical diagrams**

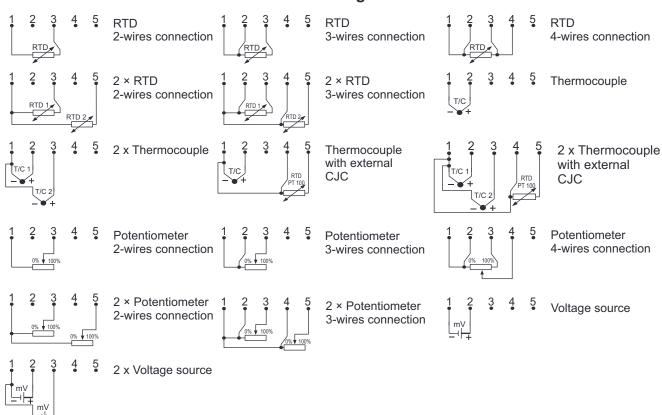

#### **Direct mounted sensors**

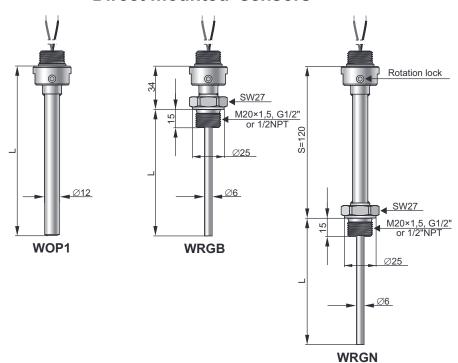

Code	Description	Shield material	Connector material
WRGN,	Spring-loaded sensors (to use with	316L (Pt100)	316
WRGB	additional thermowell)	Inconel 600 (TC)	310
WOP1	Sensor with integrated thermowell	316L	-



## Ordering code

Model		Code		Description			
LI-24				Smart temperature transmitter			
	/AI W			olay, output 4-20mA + Hart			
Versions	/ALW/Safety						
			Stainless	steel housing			
	/Exia		<b>E</b>	II 2(1)G Ex ia [ia Ga] IIC T4/T5/T6 Gb II 1/2G Ex ia IIC T4/T5/T6 Ga/Gb (with direct sensor) Safety version: II 2(1)G Ex ia [ia Ga] IIC T4 Gb			
		/Exia (Da)		Ex ia [ia Ga] IIC T4/T5/T6 Gb Ex ia IIC T4/T5/T6 Ga/Gb (with direct sensor) Safety version: Ex ia [ia Ga] IIC T4 Gb			
	/Exia (Da)			II 2(1)G Ex ia [ia Ga] IIC T4 Gb II 1D Ex ia IIIC T105°C Da I M1 Ex ia I Ma (with 316ss case)			
				Ex ia [ia Ga] IIC T4 Gb Ex ia IIIC T105°C Da Ex ia I Ma (with 316ss case)			
Certificates, options*	/Exd			With remote sensor: II 2(1)G Ex db [ia Ga] IIC T5/T6 Gb II 2(1)D Ex tb [ia Da] IIIC T100°C/T85°C Db I M2 Ex db [ia Ma] I Mb (with 316ss case)			
			€x	With direct sensor WO/WR: II 2G Ex db IIC T**/T5/T6 Gb II 2D Ex tb IIIC T*/T100°C/T85°C Db I M2 Ex db I Mb (with 316ss case)			
					ng gland available on request		
				With remote sensor:  Ex db [ia Ga] IIC T5/T6 Gb  Ex tb [ia Da] IIIC T100°C/T85°C Db  Ex db [ia Ma] I Mb (with 316ss case)	on request		
				With direct sensor WO/WR:  Ex db IIC T**/T5/T6 Gb  Ex tb IIIC T*/T100°C/T85°C Db  Ex db I Mb (with 316ss case)			
				Safety version: Ex db IIC T**/T5/T6 Gb Ex tb IIIC T*/T100°C/T85°C Db Ex db I Mb (with 316ss case)			
* more than one option		/IP67/US		1 Total Charles II Cr			
is available							
Type of measuring element /			neasuring element according to tables from page IX/7				
Measuring set range	1		Measurir				
Sensor type (optionally) /(none)		· /	Without sensor				
,, ,, ,, ,, ,, ,, ,, ,, ,, ,, ,, ,, ,,	,	/code of direct sensor		Direct mounted sensor according to below table			

Turne of course					Spring loaded sensor with threaded process connection, neck S=120mm, additional TW required.		
						Spring loaded sensor with threaded process connection, additional TW required.	
WOP1					Sensor with integrated TW.		
Special version					Intrinsic safe version		
		/Exd	xd			Explosion proof version	
Length of sensor	Length of sensor /L=mm			Required length of immersion [mm]			
Neck extension	dension /S=mm		extension /S=mm Required length of neck [mm] (if different than standard)		Required length of neck [mm] (if different than standard)		
Process connection			Thread type				
Type of measuring element			Type of measuring element				
Sensor material		•	Sensor material (if different than standard)				
Connection thread between sensor and transmitter			Thread between sensor and transmitter				